



Environmental Support Network, Inc.

5376 Fulton Drive, NW – Canton, Ohio 44718 – (330) 494-0905
www.environmental-support.com

November 14, 2012

Mr. Jay Dahl
Project Manager
BJAAM Environmental, Inc.
P.O. Box 523
472 Elm Ridge Avenue
Canal Fulton, Ohio 44614
(330) 854-5300

RE: The Former Stewart Brothers Paint
Large Maintenance Storage Shed
Alliance, Ohio

Dear Jay,

The following includes the results from the asbestos sampling that you requested.

On November 5, 2012, Environmental Support Network, Inc. acquired samples of construction materials from the former Stewart Brothers Paint Property's Large Maintenance Storage Shed located at 1010 North Union Avenue in, Alliance Ohio 44601. The samples were taken of the construction materials resident in the building. Random sampling was conducted pursuant to 40 CFR 763.86. The construction materials sampled are those materials that might become friable during the forces of the planned demolition activity. The purpose of conducting this sampling was to acquire pre-demolition samples of construction materials to satisfy the National Emissions Standards for Hazardous Air Pollutants (NESHAP's) regulations as codified in 40 CFR Part 61.

During this inspection, six-(6) samples were taken. The samples were drywall walls (W), drywall ceilings (C), and building insulation which may become disturbed and friable during the course of the demolition activities. The following chart presents a description of the materials sampled and the associated analytical results.

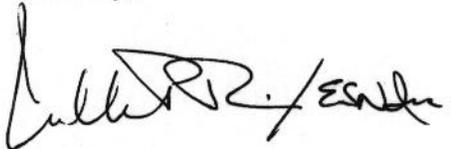
#	LOCATION	AREA	TYPE	COLOR	TEXTURE	RESULT
01	LStorage-1F	RestroomW-N	Drywall	White	Hard,Smooth	NAD
02	LStorage-1F	StorageW-C	Drywall	White	Hard,Smooth	NAD
03	LStorage-1F	RestroomC-C	Drywall	White	Hard,Smooth	NAD
04	LStorage-1F	StorageC-C	Drywall	White	Hard,Smooth	NAD
05	LStorage-1F	Attic-W	Insulation	Brown	Soft,Granular	NAD
06	LStorage-1F	Attic-C	Insulation	Brown	Soft,Granular	NAD

The aforementioned samples were analyzed utilizing Polarized Light Microscopy (PLM). Sample analysis was conducted pursuant to EPA Method 600/R-93/116. The samples were submitted to an independent testing laboratory known as Environmental Hazards Services in Richmond, Virginia. Environmental Hazards Services is a participant in the National Voluntary Laboratory Accreditation Program (NVLAP).

As can be seen from the above, all of the samples were negative for asbestos content. The NAD designation means, "no asbestos detected" in the sample submitted. These materials need not be removed prior to demolition.

Finally, Jay if you have any questions regarding the above please contact me at (330) 494-0905. As always, thank you.

Sincerely,

A handwritten signature in black ink, appearing to read "William P. Racine". The signature is stylized and includes a large, sweeping flourish that extends to the right.

William P. Racine
Environmental Consultant
CAHES #31746

ATTACHMENT A

BULK ASBESTOS SAMPLING BY PLM



Environmental Support Network, Inc.

5376 Fulton Drive, NW – Canton, Ohio 44718 – (330) 494-0905

CHAIN OF CUSTODY

Result

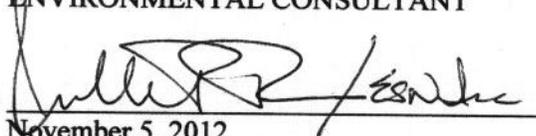
CLIENT: ENVIRONMENTAL SUPPORT NETWORK, INC.
5376 FULTON DRIVE, NW
CANTON, OHIO 44718
PHONE: (330) 494-0905 FAX: (330) 494-1650

SITE: BJAAM-SB-LSS
Alliance, OH

ANALYSIS: POLARIZED LIGHT MICROSCOPY
BULK ASBESTOS ANALYSIS

#	LOCATION	AREA	TYPE	COLOR	TEXTURE	TEST
01	LStorage-1F	RestroomW-N	Drywall	White	Hard,Smooth	PLM
02	LStorage-1F	StorageW-C	Drywall	White	Hard,Smooth	PLM
03	LStorage-1F	RestroomC-C	Drywall	White	Hard,Smooth	PLM
04	LStorage-1F	StorageC-C	Drywall	White	Hard,Smooth	PLM
05	LStorage-1F	Attic-E	Insulation	Brown	Soft,Granular	PLM
06	LStorage-1F	Attic-W	Insulation	Brown	Soft,Granular	PLM

SAMPLER: WILLIAM P. RACINE – CAHES #31746
ENVIRONMENTAL CONSULTANT

SIGNATURE: 
DATE: November 5, 2012

LAB: ENVIRONMENTAL HAZARDS SERVICES, INC.
7469 WHITE PINE ROAD
RICHMOND VIRGINIA 23237

LAB SIGN.: _____
DATE: November 6, 2012

BJAAM-SB-LStorage-COC



Asbestos Bulk Analysis Report

Environmental Hazards Services, L.L.C.
7469 Whitepine Rd
Richmond, VA 23237
Telephone: 800.347.4010

Report Number: 12-11-00608

Client: Environmental Support Network
5376 Fulton Drive NW
Canton, OH 44718

Received Date: 11/06/2012
Analyzed Date: 11/07/2012
Reported Date: 11/07/2012

Project/Test Address: BJAAM-SB-LSS; Alliance, OH

Client Number:
36-1963

Fax Number:
330-494-1650

Laboratory Results

Lab Sample Number	Client Sample Number	Layer Type	Lab Gross Description	Asbestos	Other Materials
12-11-00608-001	01		White Powdery; Brown Fibrous; Inhomogeneous	NAD	14% Cellulose 86% Non-Fibrous
12-11-00608-002	02		White Powdery; Chalky; Brown Fibrous; Inhomogeneous	NAD	10% Cellulose 90% Non-Fibrous
12-11-00608-003	03		White Powdery; Chalky; Brown Fibrous; Inhomogeneous	NAD	18% Cellulose 82% Non-Fibrous
12-11-00608-004	04		White Powdery; Brown Fibrous; Inhomogeneous	NAD	15% Cellulose 85% Non-Fibrous
12-11-00608-005	05		Brown Fibrous; Homogeneous	NAD	95% Cellulose 5% Non-Fibrous

Rev 1.0 (Revised On: 11/07/2012): Amended client sample # to read 05.

Environmental Hazards Services, L.L.C

Client Number: 36-1963
Project/Test Address: BJAAM-SB-LSS; Alliance, OH

Report Number: 12-11-00608

Lab Sample Number	Client Sample Number	Layer Type	Lab Gross Description	Asbestos	Other Materials
12-11-00608-006	06		Brown Fibrous; Homogeneous	NAD	97% Cellulose 3% Non-Fibrous

QC Sample: 58-M22004-4
QC Blank: SRM 1866 Fiberglass
Reporting Limit: 1% Asbestos
Method: EPA Method 600/R-93/116, EPA Method 600/M4-82-020
Analyst: Katherine Charles Harris

Reviewed By Authorized Signatory:



Tasha Eaddy
QA/QC Clerk

The condition of the samples analyzed was acceptable upon receipt per laboratory protocol unless otherwise noted on this report. Each distinct component in an inhomogeneous sample was analyzed separately and reported as a composite. Results represent the analysis of samples submitted by the client. Sample location, description, area, volume, etc., was provided by the client. This report cannot be used by the client to claim product endorsement by NVLAP or any agency of the U.S. Government. This report shall not be reproduced except in full, without the written consent of the Environmental Hazards Service, L.L.C. California Certification #2319 NY ELAP #11714. All information concerning sampling location, date, and time can be found on Chain-of-Custody. Environmental Hazards Services, L.L.C. does not perform any sample collection.

Environmental Hazards Services, L.L.C. recommends reanalysis by point count (for more accurate quantification) or Transmission Electron Microscopy (TEM), (for enhanced detection capabilities) for materials regulated by EPA NESHAP (National Emission Standards for Hazardous Air Pollutants) and found to contain less than ten percent (<10%) asbestos by polarized light microscopy (PLM). Both services are available for an additional fee.

400 Point Count Analysis, where noted, performed per EPA Method 600/R-93/116 with a Reporting Limit of 0.25%.

* All California samples analyzed by Polarized Light Microscopy, EPA Method 600/M4-82-020, Dec. 1982.

LEGEND: NAD = no asbestos detected



Analyst Signature Page

Environmental Hazards Services, L.L.C.

7469 Whitepine Rd
Richmond, VA 23237

Telephone: 800.347.4010

Report Number: 12-11-00608

Client: Environmental Support Network
5376 Fulton Drive NW
Canton, OH 44718

Received Date: 11/06/2012

Analyzed Date: 11/07/2012

Reported Date: 11/07/2012

Client Number: 36-1963

Project/Test Address: BJAAM-SB-LSS; Alliance, OH

Analyst(s)

Katherine Charles Harris

Katherine Charles Harris



WPM

Environmental Support Network, Inc.

5376 Fulton Drive, NW - Canton, Ohio 44718 - (330) 494-0905

CHAIN OF CUSTODY

Rush


CLIENT: ENVIRONMENTAL SUPPORT NETWORK, INC.
5376 FULTON DRIVE, NW
CANTON, OHIO 44718
PHONE: (330) 494-0905 FAX: (330)-494-1650

SITE: BJAAM-SB-LSS
Alliance, OH


ANALYSIS: POLARIZED LIGHT MICROSCOPY
BULK ASBESTOS ANALYSIS

#	LOCATION	AREA	TYPE	COLOR	TEXTURE	TEST
01	LStorage-1F	RestroomW-N	Drywall	White	Hard,Smooth	PLM
02	LStorage-1F	StorageW-C	Drywall	White	Hard,Smooth	PLM
03	LStorage-1F	RestroomC-C	Drywall	White	Hard,Smooth	PLM
04	LStorage-1F	StorageC-C	Drywall	White	Hard,Smooth	PLM
05	LStorage-1F	Attic-E	Insulation	Brown	Soft,Granular	PLM
06	LStorage-1F	Attic-W	Insulation	Brown	Soft,Granular	PLM

SAMPLER: WILLIAM P. RACINE - CAHES #31746
ENVIRONMENTAL CONSULTANT

SIGNATURE: 
DATE: November 5, 2012

LAB: ENVIRONMENTAL HAZARDS SERVICES, INC.
7469 WHITE PINE ROAD
RICHMOND VIRGINIA 23237

LAB SIGN.: 
DATE: November 6, 2012

12-11-00608



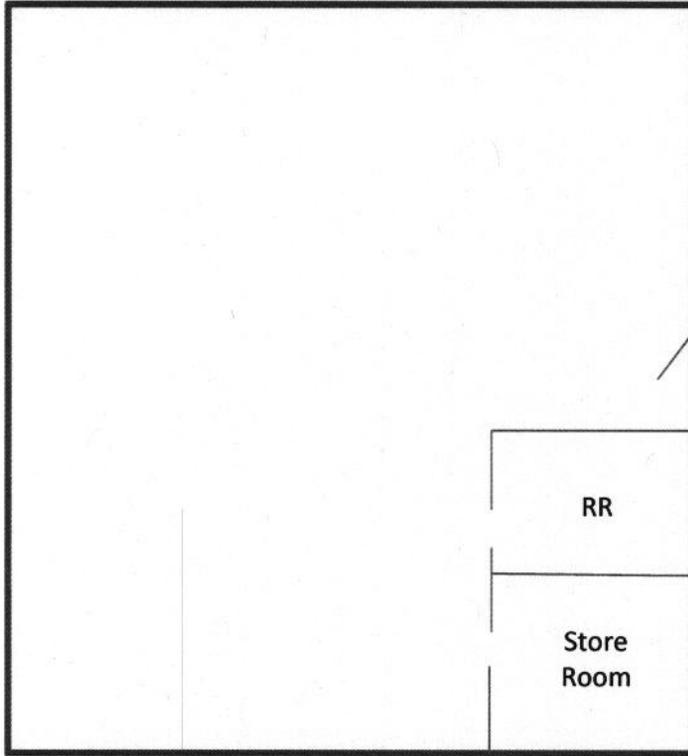
Due Date:
11/07/2012
(Wednesday)
W



BJAAM-SB-LStorage-COC

ATTACHMENT B

Site Sketch



Large
Maintenance
Storage
Building

Sewart
Brothers Paint
Property